

Example of usage

## Through hole fitting screw

## MT series (100pcs/pack)

- This screw is soldered and fixed to a through hole.
- The convex part inside the head can securely lift the solder to the part face side.
- Flow soldering can be used by using a set washer.
- This is used for fitting crimping terminal, heat dissipation board, panel etc.
- Material: Brass
- Finish: Tin plating over nickel base

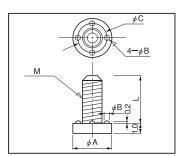

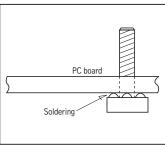


## Part No.

Part No.	Α	L	М	В	С
2MT-3	4	3	M2 P=0.4	0.5	3
2MT-4	4	4	M2 P=0.4	0.5	3
2MT-5	4	5	M2 P=0.4	0.5	3
2MT-6	4	6	M2 P=0.4	0.5	3
2MT-7	4	7	M2 P=0.4	0.5	3
2MT-8	4	8	M2 P=0.4	0.5	3
2MT-9	4	9	M2 P=0.4	0.5	3
2MT-10	4	10	M2 P=0.4	0.5	3
2.6MT-5	5	5	M2.6 P=0.45	0.6	3.8
2.6MT-6	5	6	M2.6 P=0.45	0.6	3.8
2.6MT-7	5	7	M2.6 P=0.45	0.6	3.8
2.6MT-8	5	8	M2.6 P=0.45	0.6	3.8
2.6MT-9	5	9	M2.6 P=0.45	0.6	3.8
2.6MT-10	5	10	M2.6 P=0.45	0.6	3.8
3MT-5	6	5	M3 P=0.5	0.7	4.5
3MT-6	6	6	M3 P=0.5	0.7	4.5
3MT-7	6	7	M3 P=0.5	0.7	4.5
3MT-8	6	8	M3 P=0.5	0.7	4.5
3MT-9	6	9	M3 P=0.5	0.7	4.5
3MT-10	6	10	M3 P=0.5	0.7	4.5
4MT-5	8	5	M4 P=0.7	1.0	6
4MT-6	8	6	M4 P=0.7	1.0	6
4MT-7	8	7	M4 P=0.7	1.0	6
4MT-8	8	8	M4 P=0.7	1.0	6
4MT-9	8	9	M4 P=0.7	1.0	6
4MT-10	8	10	M4 P=0.7	1.0	6


## Set washer (100pcs/pack)

- Please fit the washer from above and to the screw to fix the screw during flow soldering.
- After soldering, please remove it.
- Material: 6 nylon (UL94HB)

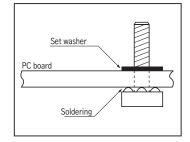





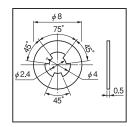





¢8 75° ¢2.8 45°

Part No.:3MT-W

(For M3)





Part No.:4MT-W (For M4)